

taurus

RCC.TAU.SEMIHORECA(MY-COOK-1800 SH)

Code: 923007000

6KA




Taurus Household Appliances
After-Sales Service

Kitchen Machine

Mycook 1.8 Semihoreca



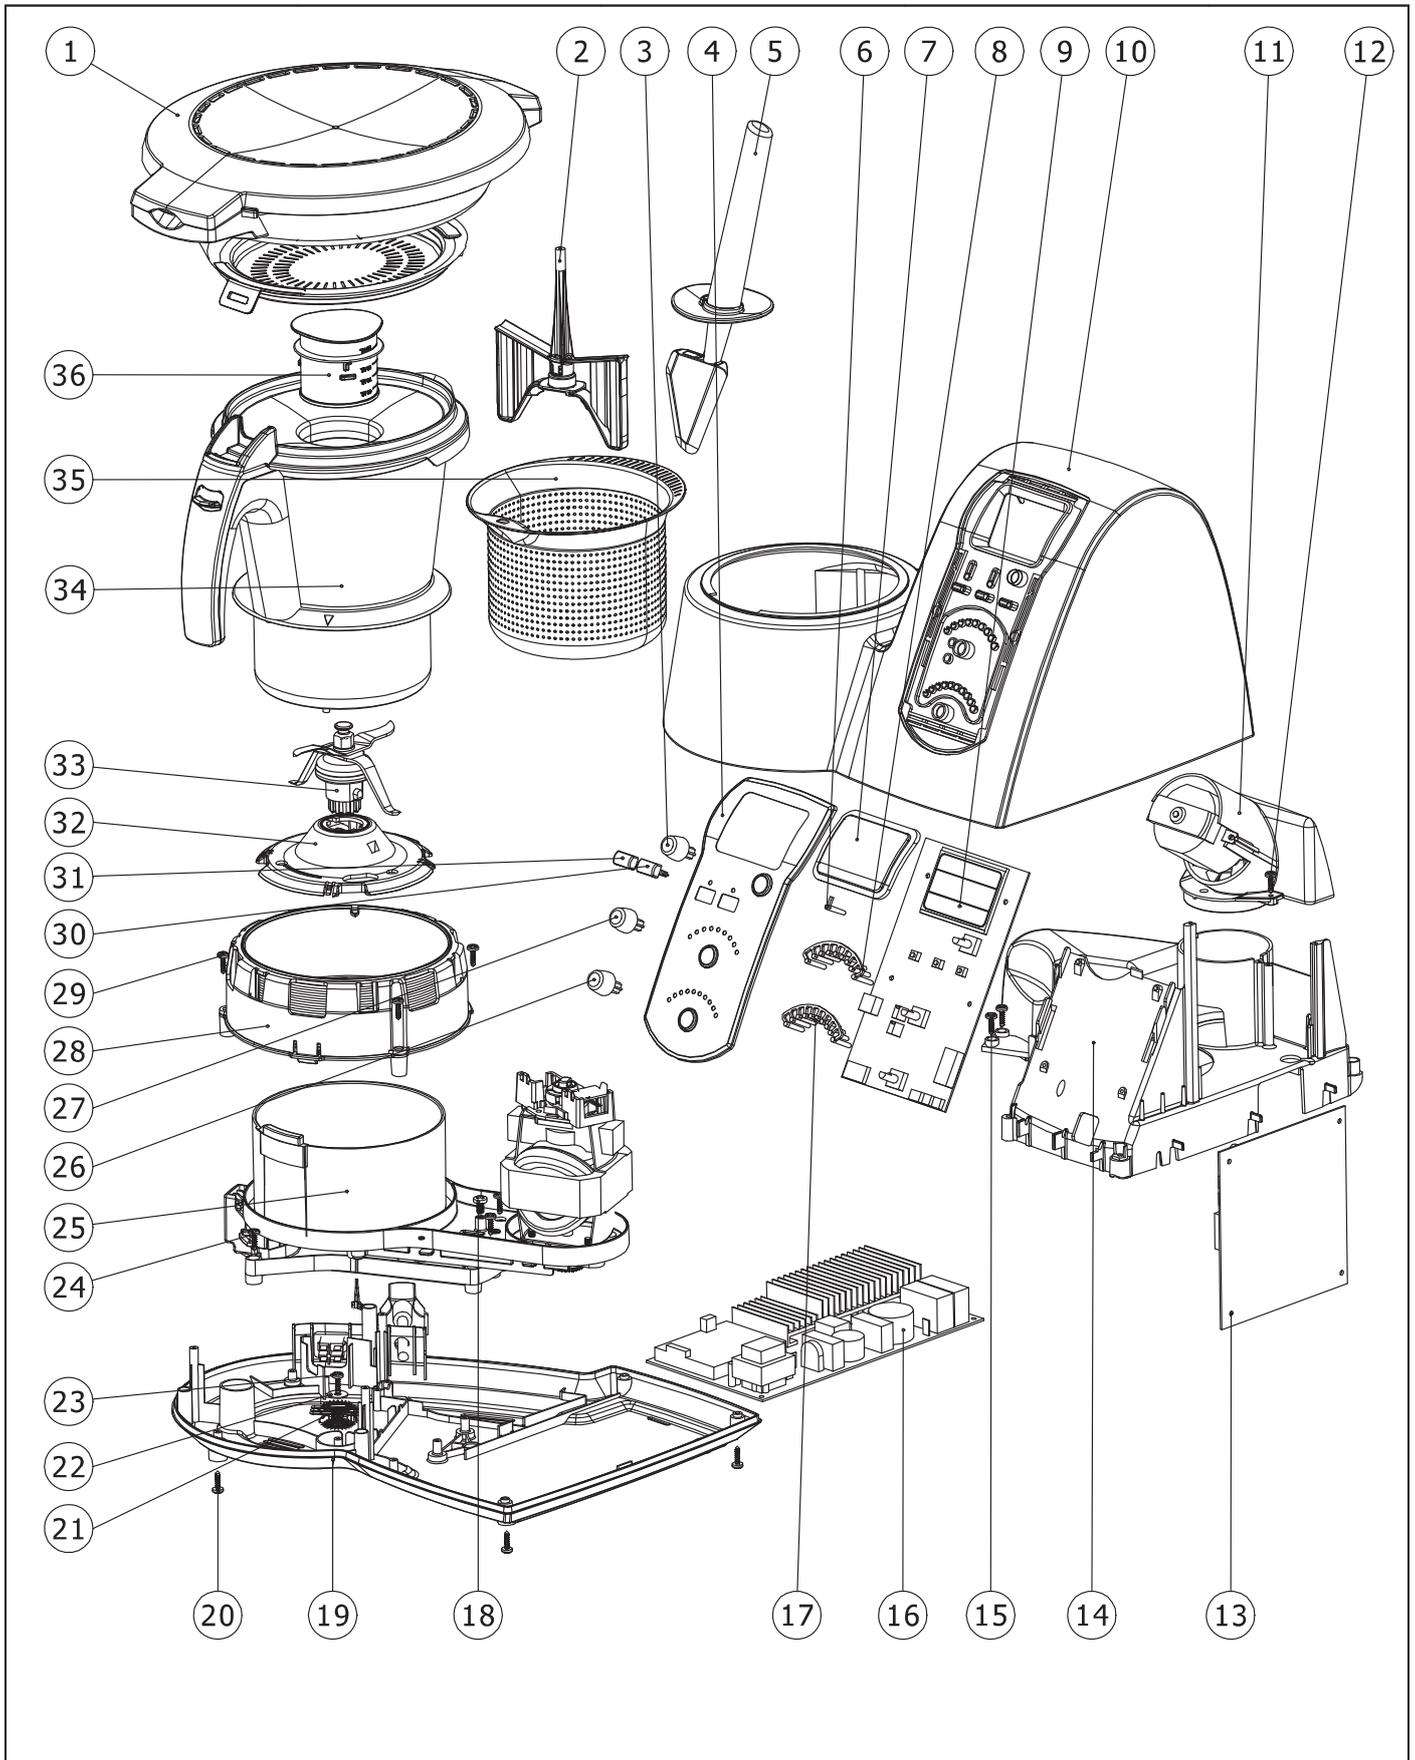

taurus

RCC.TAU.SEMIHORECA(MY-COOK-1800 SH)

Code: 923007000

6KA

PART nr.	PART CODE	NOMBRE PARTE (SPANISH)	PART NAME (ENGLISH)	QTY
36	231913000	VASO DOSIFICADOR (CUBILETE)	FEEDER VESSEL (Goblet)	1
35	011535000	CESTILLO COLADOR	STRAINER BASKET	1
34	528095000	CONJUNTO JARRA	JUG SET	1
33	374755000	CONJUNTO CUCHILLAS	BLADES SET	1
32	232107000	CONJUNTO SOPORTE JARRA CON BRIDA	JUG SET SUPPORT FLANGE	1
31	233016000	TECLA AMASADO	DOUGH KEY	1
30	233016000	TECLA TURBO	TURBO KEY	1
29	040088000	TORNILLO ALOMADO DIN 7981 3,5x13 (FIJAN BOBINA INDUCCION A LA BASE)	SCREW 3,5x13 pan head DIN 7981 (FIXED BASE COIL induction)	3
28	074215000	CONJUNTO BOBINA INDUCCION	INDUCTION COIL SET	1
27	233015000	MANDO TEMPERATURAS	TEMPERATURE CONTROL	1
26	233015000	MANDO VELOCIDADES	SPEED CONTROL	1
25	476267000	CONJUNTO CHASIS	CHASSIS SET	1
24	040088000	TORNILLO ALOMADO DIN 7981 3,5x13 (FIJAN CONJUNTO CHASIS A LA BASE)	SCREW 3,5x13 pan head DIN 7981 (FIX CHASSIS TO BASE)	4
23	040088000	TORNILLO ALOMADO DIN 7981 3,5x13 (FIJA BOBINA CHOQUE A LA BASE)	SCREW 3,5x13 pan head DIN 7981 (FIX COIL SHOCK TO BASE)	1
22	041317000	ARANDELA CELOTEX 15x4x0,7	WASHER CELOTEX 15x4x0,7	1
21	053006000	BOBINA DE CHOQUE	CHOCK COIL	1
20	040088000	TORNILLO ALOMADO DIN 81 3,6x16 (CIERRAN EL APARATO)	SCREW 3,6x16 DIN 81 (CLOSES THE UNIT)	6
19	374779000	CONJUNTO BASE	BASE BODY	1
18	040025000	TORNILLO TAPTITE DIN 7985 M-4x8 TOMA TIERRA	TAPTITE SCREW DIN 7985 M-4x8 EARTH	1
17	233006000	MIRILLA VELOCIDADES	SPEED WINDOW	1
16	069329000	PLACA PCB INDUCCION	PCB INDUCTION	1
15	040088000	TORNILLO ALOMADO DIN 7981 3,5x13 (FIJAN CONEXION RED A LA BASE)	SCREW 3,5x13 pan head DIN 7981 (FIXES NETWORK CONNECTOR TO BASE)	2
14	222476000	SOPORTE MOTOR VENTILACION Y CIRCUITOS	MOTOR FAN SUPPORT AND CIRCUITS	1
13	069362000	PLACA PCB POTENCIA	PCB POWER	1
12	040088000	TORNILLO ALOMADO DIN 7981 3,5x13 (FIJAN CONJUNTO VENTILADOR AL SOPORTE)	SCREW 3,5x13 pan head DIN 7981 (FIXES FAN MOTOR)	2
11	374770000	CONJUNTO VENTILADOR	FAN SET	1
10	233009000	CUERPO	BODY	1
9	069363000	PLACA PCB CONTROL	PCB CONTROL BOARD	1
8	233007000	MIRILLA TEMPERATURAS	TEMPERATURES WINDOW	1
7	222483000	DISPLAY PC	DISPLAY PC	1
6	233008000	MIRILLA AMASADO	PUG MIRILLA	1
5	374789000	CONJUNTO ESPATULA	JOINT SPATULA	1
4	211812000	EMBELLECEDOR CON ADHESIVO	COVER WITH LABEL	1
3	233015000	MANDO TIEMPO	TIME CONTROL	1
2	231922000	PALETA MEZCLADORA	MIXING PADDLE	1
1	999116000	CONJUNTO BANDEJA VAPOR	STEAM TRAY SET	1



Exploded (1/2)



026062000



026065000



026401000




036081000



039296000



052108000

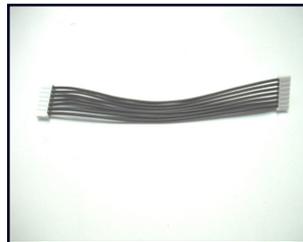

069210000



069212000



069326000



069327000



069328000



069329000



069362000



069363000



069347000



074215000



082207000



211812000



221102000



222420000



Exploded (2/2)



222421000



222476000



222424000



222425000



231910000



231911000



231912000



232106000



232107000



231932000



232109000 6KA
231952000 CAV



233015000




233016000



233009000



328301000

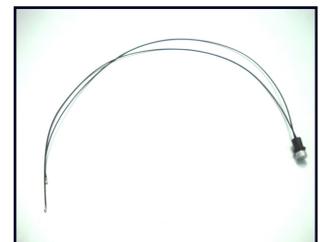

369215000




053006000



374770000



374779000

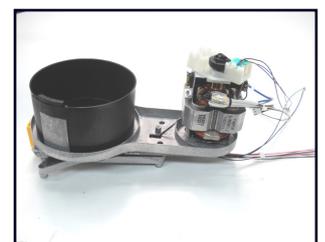

476267000



Codes (1/2)

CODE	DESCRIPTION
026062000	MYCOOK BLADES SILICON SEALING RING
026065000	JAG LID SILICON SEALING RING (Ver 2)
026401000	HID 3M 4867 TOOTHED BELT
036081000	NTC STAINLESS STEEL SPRING
039296000	FOOD PROCESSOR MAINS CONNECTION
052108000	NTC JAR CONNECTOR
053006000	COIL SHOCK 10mHH
069210000	PCI CONNECTOR PCI INDUCTION CONTROL
069212000	PCI CONNECTOR PCI POWER CONTROL
069326000	HALL PCI TACHOMETER WITH CONNECTOR
069327000	JAR HALL PCI WITH PRESENCE CONNECTOR
069328000	NTC COIL PCI
069329000	INDUCTION PCI
069347000	SWITCH WITH PROTECTIVE COVER
069362000	C. PCI MY COOK POWER STANDBY (VER 2)
069363000	C. PCI COOK MY CONTROL STANDBY (VER 2)
074215000	INDUCTION COIL COOK MY CU-AL
082207000	UNIVERSAL MOTOR SEMIHOREA
211812000	CONTROL FRONT COVER TAMP.SEMIHOR
221102000	MYCOOK SUPPORT DOWEL BLACK




Codes (2/2)


CODE	DESCRIPTION
222420000	MOTOR NTC TACHOMETER SUPPORT
222421000	FERRITE MULTI-POLE MOTOR SHAFT SUPPORT
222424000	HTD 3M TOOTHED WHEEL 60 TEETH
222425000	TOOTHED WHEEL 26 TEETH
222476000	FAN SUPPORT AND CIRCUITS (VER 2)
231910000	MYCOOK HANDLE CONTROL
231911000	JAR LOWER HANDLE
231912000	JAR UPPER HANDLE
232106000	JAR BLADES SUPPORT (VER 2)
232107000	JAR BLADES FIXING CLAMP (VER 2)
232108000	CHASSIS JAR COUPLER (VER 2)
232109000	BLADES SHAFT DRIVE PINION (VER 2)
233009000	SEMIHORECA PAINTED BODY. TOYOTA 1G3 TAM
233015000	TEMPERATURE-SPEED KNOB
233016000	KEY SEMI-HORECA
328301000	CHASSIS WITH GEAR AND BEARING
369215000	JAR TEMPERATURE SENSOR
374770000	FAN MOTOR WITH TURBINE
374779000	BASE ASSEMBLY SEMI-HORECA
476276000	SET CHASSIS-ENGINE TEMPERATURE SENSOR.(VER 2)



Accesories

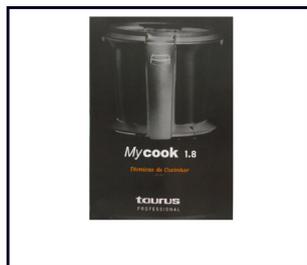

062827000

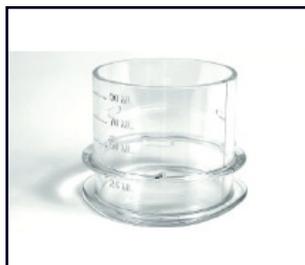

231913000



231914000



231922000



374755000



374823000



374789000



428129000




476274000



580095000



999208000

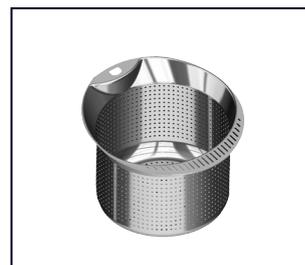

999210000

Codes Accesories

CODE	DESCRIPCIÓN
062827000	TECHNICAL GUIDE KITCHEN
231913000	MY OOK MEASURING CUP
231914000	MY COOK JAR LID
231922000	MY COOK MIXING BLADE
374755000	MY COOK BLADES ASSEMBLY
374823000	TOP PITCHER SET AFTER SALES (VER 2)
374789000	C.ESPATULA MONOBLOCK
428129000	MY COOK JAR+BOX+PACKING BAG+TRIM RING (No blades)
476274000	PITCHER SET WITH BLADES (VER 2)
580095000	MY COOK JAR WITH LID ASSEMBLY (VER 2)
999208000	STEAMER ACCESORY
999210000	BASKET MY COOK



Problems and Remedies 1/1

ANOMALY	MESSAGE ON DIGITAL SCREEN	REPAIR
The digital screen displays ERR4.		Possible overload of the motor. Remove the food from the jar.
The digital screen displays ERR5.		Possible overload of the motor. Leave the appliance to cool.
The digital screen displays ERR1, 2, 3, 6, 7, 10.		Disconnect / connect the electrical current. If "error" still appears, write down the number and take the appliance to the Authorized Technical Assistance Services.
The digital screen displays ERR8.		Possible overheating of the induction. Disconnect from the mains and remove the jar. Leave to cool.
The digital screen displays ERR9.		Possible overheating of the induction. Disconnect from the mains and remove the jar. Leave to cool. If "error" still appears, write down the number and take the appliance to the Authorized Technical Assistance Service.
The digital screen displays ERR11.		The jar and/or the lid have become detached. Attach the lid and the jar correctly.

ANOMALY	REPAIR
It does not turn on	Check whether it is connected to the mains. Check that the general switch is in an "ON" position. Check that the lid and the jar are well attached.
It does not heat	Check that you have done the following: 1 Selected time. 2 Selected temperature. 3 Selected speed.
It heats too much	Check that you have selected the correct temperature. Check that the temperature sensor is clean and that it makes good contact with the jar.

Technical Specifications

Mode	MY COOK 1.8 SH
Typ	MY-COOK-1800SH
Voltage	220-230V 50Hz
Power	1800W

Wiring Diagram

